

Mask Set Errata 1 **68HC908AT32 Microcontroller Unit**

INTRODUCTION

This mask set errata provides information concerning the byte data link controller (BDLC) on this 68HC908AT32 MCU mask set device:

- 0H62P

MCU DEVICE MASK SET IDENTIFICATION

The mask set is identified by a 5-character code consisting of a version number, a letter, two numerical digits, and a letter, for example 0H62P. Slight variations to the mask set identification code may result in an altered version number, for example 1H62P.

MCU DEVICE DATE CODES

Device markings indicate the week of manufacture and the mask set used. The data is coded as four numerical digits where the first two digits indicate the year and the last two digits indicate the work week. For instance, the date code "9115" indicates the 15th week of the year 1991.

MCU DEVICE PART NUMBER PREFIXES

Some MCU samples and devices are marked with an SC or XC prefix. An SC prefix denotes special/custom device. An XC prefix denotes that the device is tested but is not fully characterized or qualified over the full range of normal manufacturing process variations. After full characterization and qualification, devices will be marked with the MC prefix.

When contacting a Motorola representative for assistance, please have the MCU device mask set and date code information available.

Specifications and information herein are subject to change without notice.



BYTE DATA LINK CONTROLLER (BDLC)

Refer to these two items regarding the BDLC.

Item #1

If a short-to-ground occurs on the SAE J1850 bus while a message is being transmitted, the BDLC can enter a state in which it is unable to transmit any more messages until it is reset to a known state. For this error to occur, the short-to-ground of the SAE J1850 bus must meet these strict conditions:

- The start of the J1850 bus short must occur after the bit or symbol preceding a message byte has been recognized as valid but before the rising edge of the second bit in the message byte (first active bit) has occurred. For the first byte of a message, this means that the short must occur after the start of frame (SOF) symbol has been recognized as valid and before the second bit of the byte has started. For any following message bytes, the short must start after the last bit of the previous byte has been recognized as a valid bit and before the second bit of the byte has started.
- The J1850 bus short must then short the bus long enough to prevent the second bit in the message byte from being recognized as a valid symbol. This means that if a long high symbol is being transmitted as the second bit of a byte and it is shorted to the length of a short high bit, this error will not occur. This error will manifest itself only if the second bit is shorted to a length less than that defined for a valid active symbol.

If the short-to-ground of the SAE J1850 bus does not meet the above conditions, the BDLC will not enter the state where it is unable to transmit.

If a short happens as described above, these events will occur:

- The invalid symbol flag (\$1C), which is the highest priority, will be set in the BSVR.
- The loss of arbitration (LOA) flag (\$14) may be set in the BSVR.
- The CRC flag (\$18) will be set in the BSVR after an end of data (EOD) symbol has been recognized on the bus.
- Once the short is cleared, the BDLC may transmit an active symbol onto the SAE J1850 bus before halting transmission. Or if this active symbol is transmitted, it will be interpreted as an invalid symbol by any other node on the network.
- The BDLC will then enter a lockup state (unable to transmit) and will remain in this state until either another message is received from the SAE J1850 bus or until a WAIT instruction is executed.

To remedy a short temporarily, use either of these steps. Using both steps is not necessary.

- Receive another message. When another message is received, the rising edge of the SOF symbol will reset the BDLC to its initial state, resolving the problem. The message which resets the BDLC will be received correctly.
- Execute a WAIT instruction. This instruction will place the BDLC into its reset state. Exit from wait mode can be achieved by the reception of a message from the SAE J1850 bus or through a timer or hardware interrupt.

Item #2

After placing the BDLC into 4X receive mode by configuring BCR2 to \$20, an idle bus longer than 70 μ s will generate repeating false out-of-range flags in the BSVR (\$1C). The 4X mode incoming message is received correctly whether or not the BSVR \$1C flags are cleared.

Software Workaround — Clear the BSVR \$1C invalid flags by servicing the BSVR interrupts.

How to reach us:

USA/EUROPE/Locations Not Listed: Motorola Literature Distribution, P.O. Box 5405, Denver, Colorado 80217, 1-800-441-2447 or 1-303-675-2140. Customer Focus Center, 1-800-521-6274

JAPAN: Nippon Motorola Ltd. SPD, Strategic Planning Office 4-32-1, Nishi-Gotanda Shinagawa-ku, Tokyo 141, Japan, 81-3-5487-8488


ASIA/PACIFIC: Motorola Semiconductors H.K. Ltd., 8B Tai Ping Industrial Park, 51 Ting Kok Road, Tai Po, N.T., Hong Kong, 852-26629298

Mfax™, Motorola Fax Back System: RMFAX0@email.sps.mot.com; <http://sps.motorola.com/mfax/>;

TOUCHTONE, 1-602-244-6609; US and Canada ONLY, 1-800-774-1848

HOME PAGE: <http://motorola.com/sps/>

Mfax is a trademark of Motorola, Inc.

Motorola reserves the right to make changes without further notice to any products herein. Motorola makes no warranty, representation or guarantee regarding the suitability of its products for any particular purpose, nor does Motorola assume any liability arising out of the application or use of any product or circuit, and specifically disclaims any and all liability, including without limitation consequential or incidental damages. "Typical" parameters which may be provided in Motorola data sheets and/or specifications can and do vary in different applications and actual performance may vary over time. All operating parameters, including "Typicals" must be validated for each customer application by customer's technical experts. Motorola does not convey any license under its patent rights nor the rights of others. Motorola products are not designed, intended, or authorized for use as components in systems intended for surgical implant into the body, or other applications intended to support or sustain life, or for any other application in which the failure of the Motorola product could create a situation where personal injury or death may occur. Should Buyer purchase or use Motorola products for any such unintended or unauthorized application, Buyer shall indemnify and hold Motorola and its officers, employees, subsidiaries, affiliates, and distributors harmless against all claims, costs, damages, and expenses, and reasonable attorney fees arising out of, directly or indirectly, any claim of personal injury or death associated with such unintended or unauthorized use, even if such claim alleges that Motorola was negligent regarding the design or manufacture of the part. Motorola and  are registered trademarks of Motorola, Inc. Motorola, Inc. is an Equal Opportunity/Affirmative Action Employer.

Additional mask set erratas can be found on the World Wide Web at <http://Design-NET.com/csic/TECHSPRT/TechSprt.htm>.

