

MC68HC11E9 DEVICE INFORMATION
(Rev. 1 -5/29/93)
E28B Mask Sets

The following contains information and errata that pertains to E28B and D82R mask set devices.

ERRATA

The Timer Overflow Flag in the TGLG2 register does not operate correctly when a Prescaler factor of 4, 8, or 16 is selected. Instead of setting at the \$FFFF - \$0000 transition of the Timer Counter Register (TCNT) the TOF also sets at intermediate transitions of the TCNT. The TOF operates correctly when a Prescaler factor of 1 is selected.

Revision 0.0, 20 NOV 96

last update: June 24, 1998